

Tel.: +39 040 375 5402/3 Fax.: +39 040 375 5404 e-mail: info@carso.co.uk www.carso.co.uk

Cod. Fisc. 90036690320 Partita IVA00316290329 Iscr. Reg. Imp. di Trieste No 10511

## AMS-02 STAR TRACKER

## NON CONFORMANCE REPORT

Page: 1/1

Date: November '09 Doc.: AST/NCR004

Ver.: 1.1

## NON CONFORMANCE REPORT

Non conformance Record Number NCRN004

System AMICA Star Tracker

Subsystem ASTC - AMICA Star Cracker Camera

Part Name

Part Number 240.001

Serial Number 001

Problem Description The image coming from the camera shows all

pixels at zero.

The analysis of the assembly shows that the connector carrying the video signal from the CCD to the ASTCC el. board (244.500 – J1) is not mounted properly: the height of the 5 through hole pins on the bottom is excessive. This caused an accidental interference with the AST T bridge (243.300). As a consequence the connector has been short circuited (signal to ground) and the final stage of the amplification

chain was damaged by the short circuit.

Proposed solution Readuce the height of the J1 pins on the bottom

of the ASTCC el. board (244.500). As precaution, electrically insulate the AST T bridge in the part under the video signal

connection.

Replace the final stage (op amp) of the amplification chain to make the system

functional.

Prepared by F.Santarossa

Signature